

# ULPOWER AERO ENGINES N.V.

Zonnebeekseweg 379  
B-8900 Ieper  
Belgium

## SERVICE BULLETIN

Tel. +32 57 46 61 20  
Fax +32 57 44 52 21  
e-mail: info@ulpower.com

Service Bulletin No. 2015-01

### MANDATORY

SUBJECT: Alternator fan

MODELS AFFECTED: All models with serial number lower than 153802 ( sold before November 2015)

TIME OF COMPLIANCE: before next flight

AFFECTED SERIAL NUMBER: all engines

Problem the small fixation flaps (with Ø6 mm hole) might be cracked

Solution: Replace the old style alternator fan base by the new style alternator fan base .  
(no more flaps)

#### Action

order part E052505C

Unscrew 8 bolts n° 32

Remove the complete alternator fan (28 + 29 + 30)

Change part 28 old style fan base to new style fan base

Replace the complete alternator fan (28 new style + 29 +30)

Tighten the 8 bolts n°32 to 10Nm


Parts needed : E052505C (retail price 20 EUR)



Estimated time required to replace this fan 30 minutes



SB 2015-							
Issued			Revised			Page	Revision
Mo	Day	Year	Mo	Day	Year	1 of 2	0
11	10	2015					

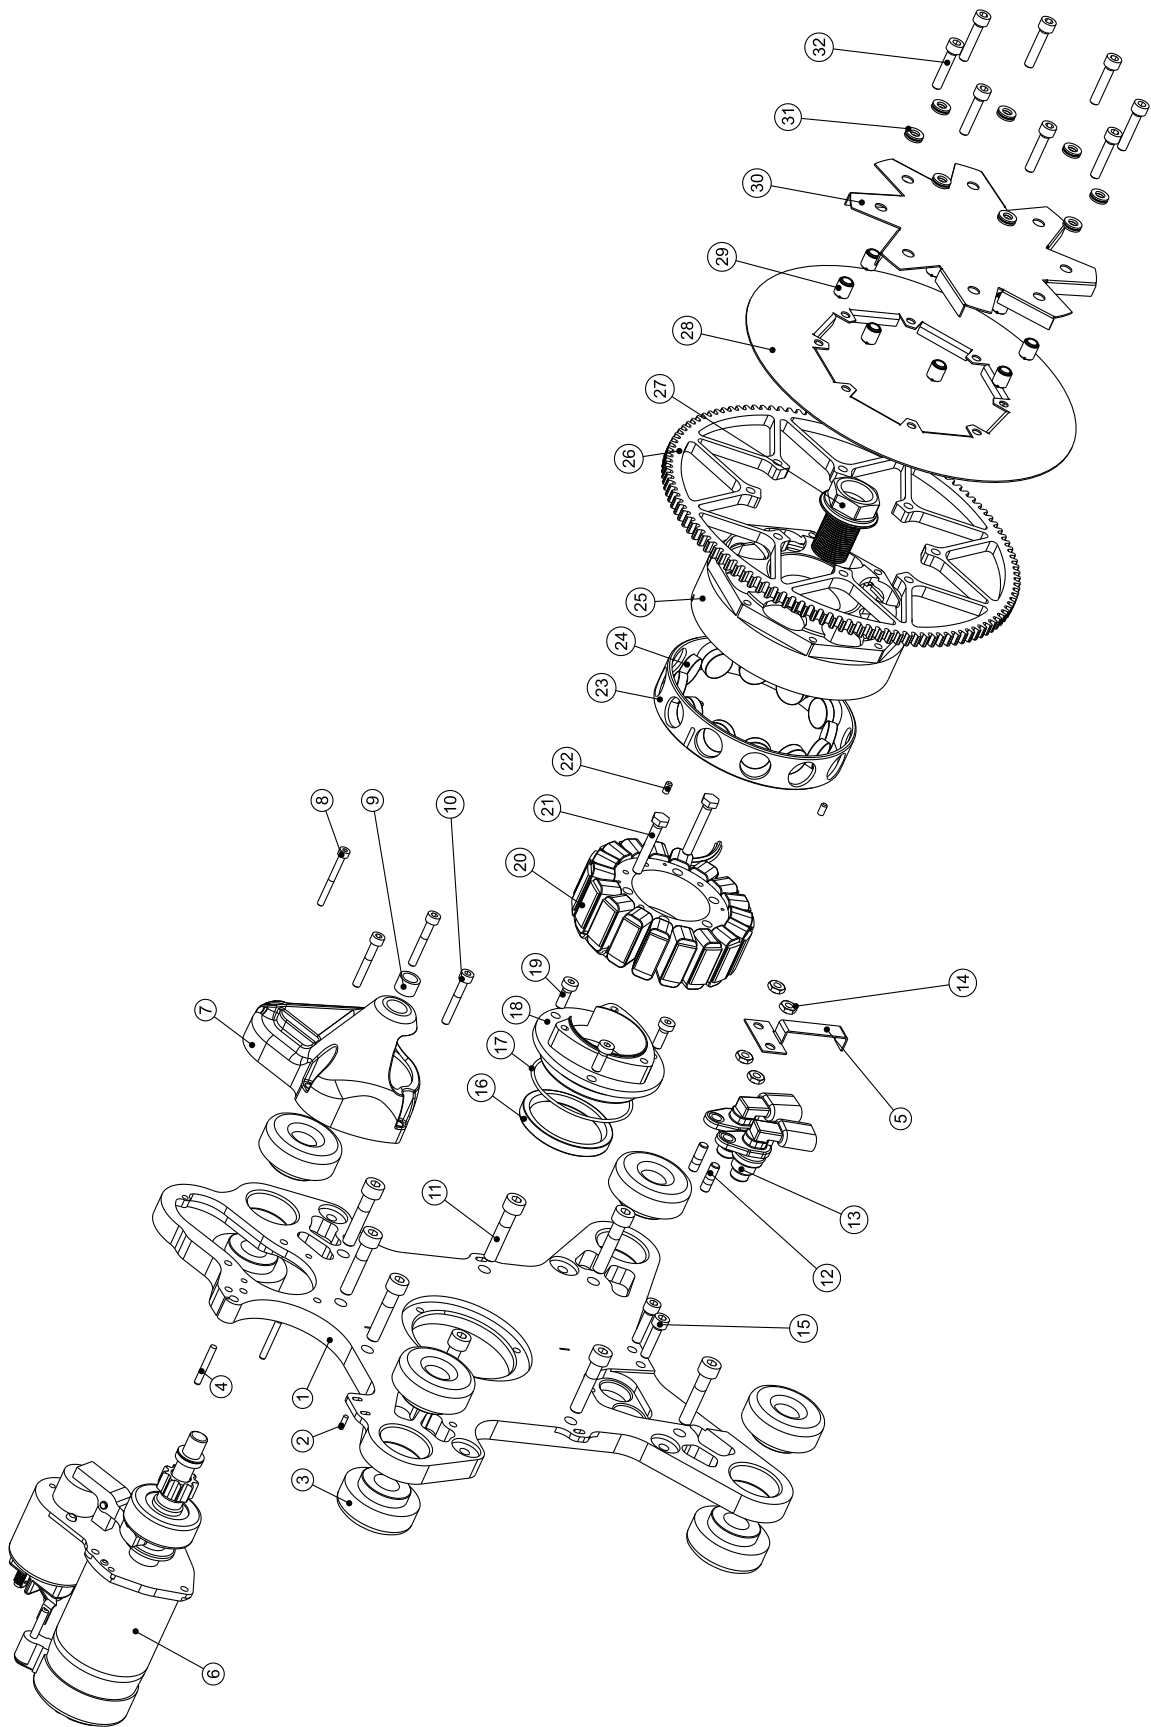

SB 2015-							
Issued			Revised			Page	Revision
Mo	Day	Year	Mo	Day	Year	2 of 2	0
11	10	2015					