

ULPOWER AERO ENGINES N.V.

Zonnebeekseweg 379
B-8900 Ieper
Belgium

SERVICE BULLETIN

Tel. +32 57 46 61 20
Fax +32 57 44 52 21
e-mail: info@ulpower.com

Service Bulletin No. 2021-01

Possible interference between the oil pick tube and adaptor in UL260ISA and UL350ISA.

MANDATORY REPLACEMENT

SUBJECT: possible interference between the oil pick up tube and adaptor

MODELS AFFECTED: UL260 ISA and UL350ISA (aerobatic engines)

TIME OF COMPLIANCE: within 10 engine hours


AFFECTED SERIAL NUMBER: 210901- 204801-204401 - 185103 -182203 – 182202
-182001- 164501-162301- 160802 – 160801 – 160701 – 112801 - 103001

WORKTIME REQUIRED: will vary from installation to installation

While repairing an aerobatic engine, our mechanics found some abnormal scratches on the oil pick up tube (see part 36 on the drawing below) . Extensive investigation showed us that some of the M18X 1.5 adaptors (see part 53 on the drawing below) may not have the expected dimensions (tolerance related). We have taken appropriate production and supply actions to resolve this and implemented them immediately.



SB 2021-01							
Issued			Revised			Page	Revision
Mo	Day	Year	Mo	Day	Year	1 of 2	0
04	19	2021					

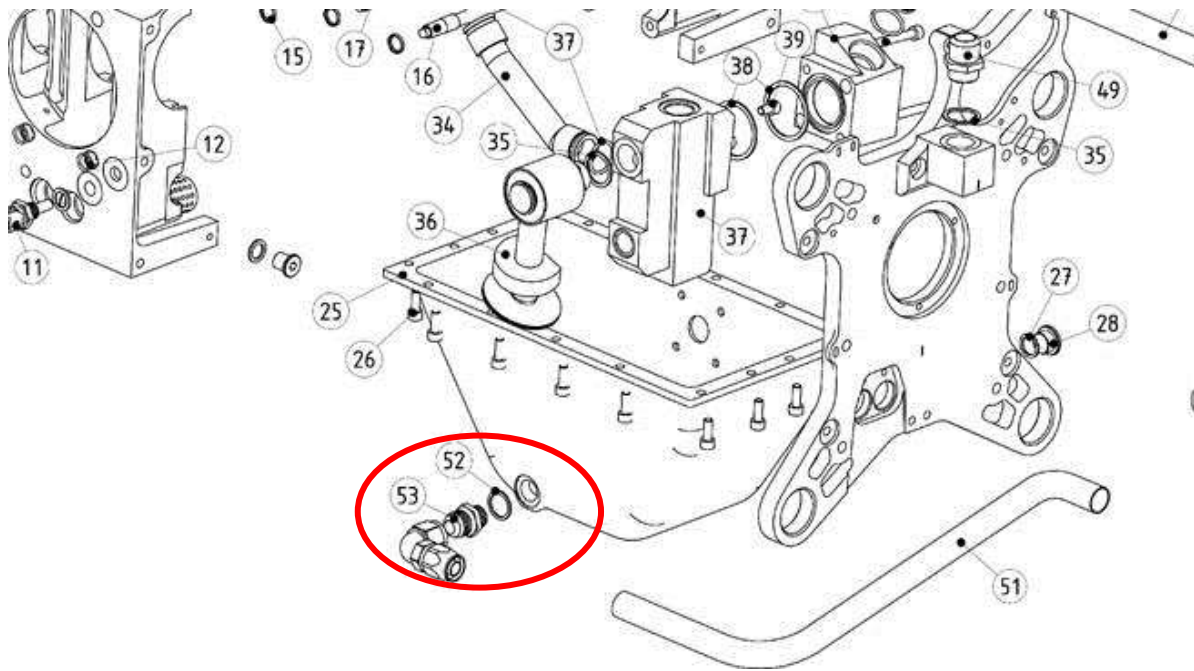

Required parts :

1 x AE010525 : retail price 13.1 euro (this is a slightly shorter version of F2560011)

1 x S3182415 : retail price 1.05 euro

(shipping cost, VAT , duties not included)

Required tools:

o Wrench size 26 – to loosen / tighten the 90° reusable 10JIC fitting (part nr. F3010090)

o Wrench size 24 – to loosen / tighten Adaptor M18x1.5 10 JIC (F2560011) .

Required action: remove part 53 (F2560011) and replace by part AE010525 (Adaptor short M18x1.5 10 JIC). Also replace the copper ring S3182415

The new parts can be purchased through your ULPower dealer.



SB 2021-01							
Issued			Revised			Page	Revision
Mo	Day	Year	Mo	Day	Year	2 of 2	0
04	19	2021					