

ULPOWER AERO ENGINES N.V.

Zonnebeekseweg 379
B-8900 Ieper
Belgium

SERVICE BULLETIN

Tel. +32 57 46 61 20
Fax +32 57 44 52 21
e-mail: info@ulpower.com

Service Bulletin No. 2015-01

MANDATORY

SUBJECT: Alternator fan

MODELS AFFECTED: All models with serial number lower than 153802 (sold before November 2015)

TIME OF COMPLIANCE: before next flight

AFFECTED SERIAL NUMBER: all engines

Problem the small fixation flaps (with Ø6 mm hole) might be cracked

Solution: Replace the old style alternator fan base by the new style alternator fan base .
(no more flaps)

Action


order part E052505C
Unscrew 8 bolts n° 32
Remove the complete alternator fan (28 + 29 + 30)
Change part 28 old style fan base to new style fan base
Replace the complete alternator fan (28 new style + 29 +30)
Tighten the 8 bolts n°32 to 10Nm

Parts needed : E052505C (retail price 20 EUR) ***Part numbers and prices are subject to changes. Contact your local agent for current prices**



SB 2015-							
Issued			Revised			Page	Revision
Mo	Day	Year	Mo	Day	Year	1 of 2	0
11	10	2015					

Estimated time required to replace this fan 30 minutes

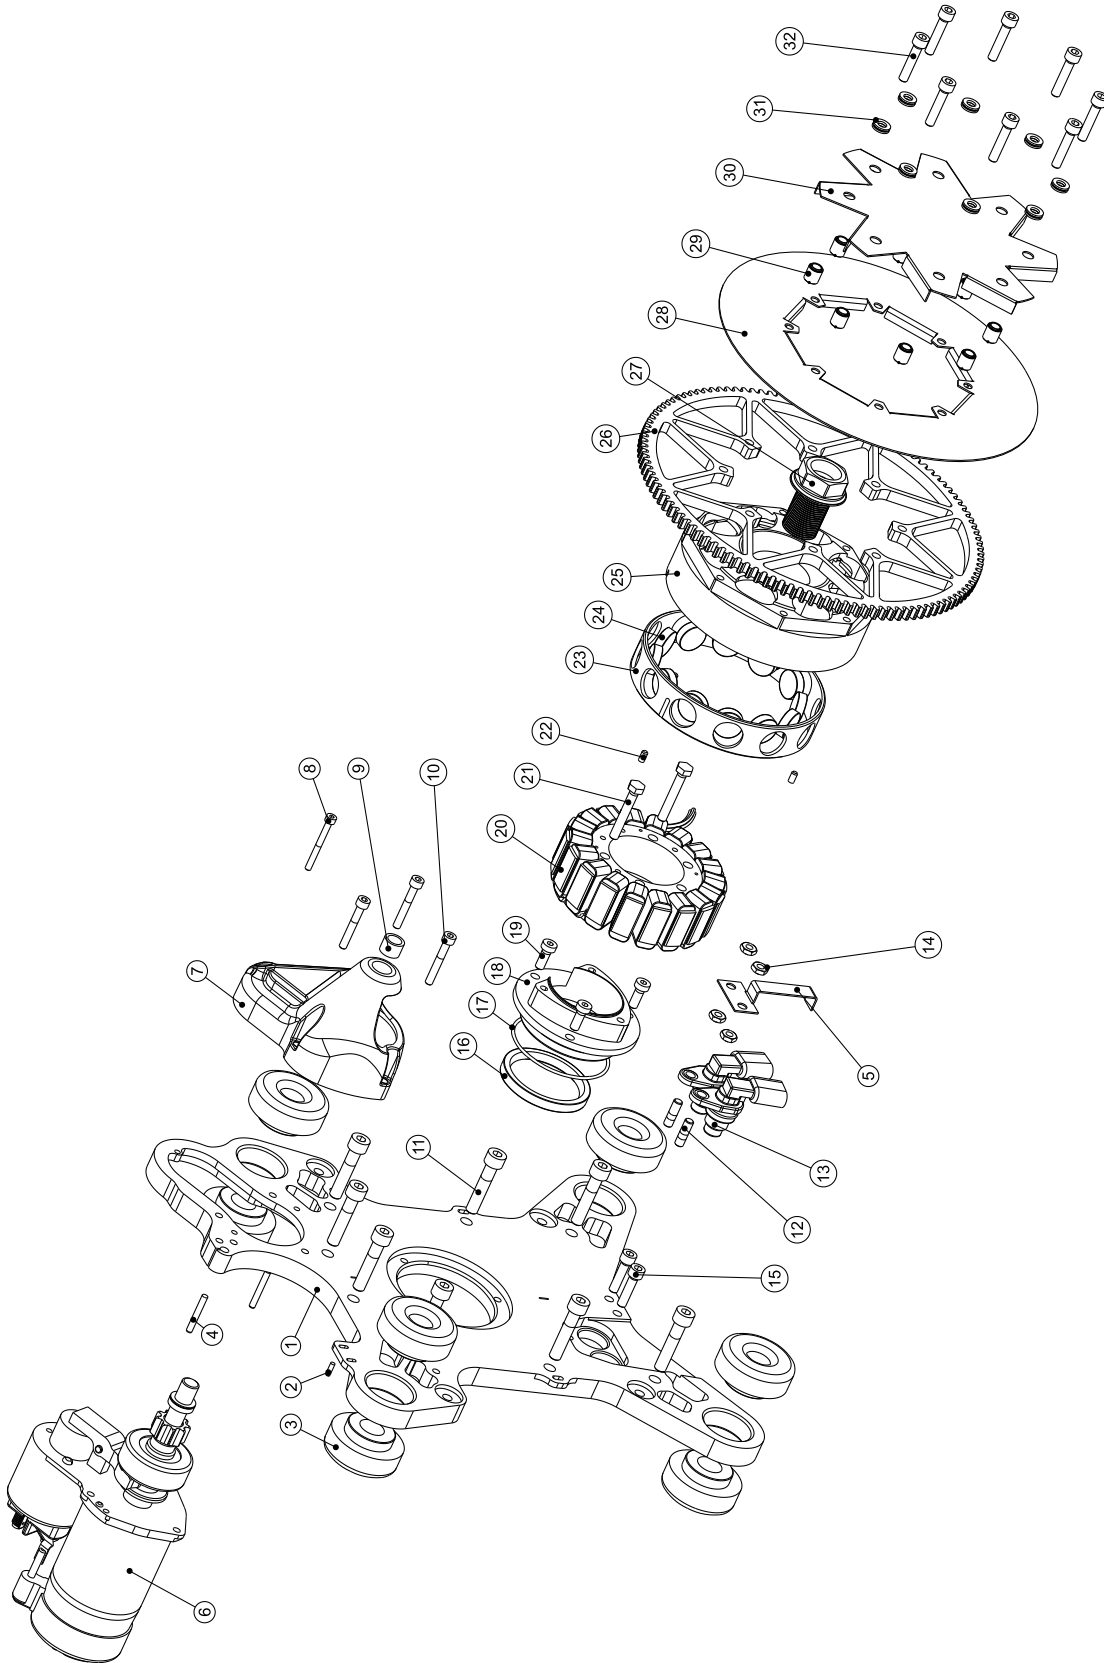

SB 2015-							
Issued			Revised			Page	Revision
Mo	Day	Year	Mo	Day	Year	2 of 2	0
11	10	2015					